

MITSUBISHI HEAVY INDUSTRIES AMERICA INC.

MITSUBISHI SERVICE PUBLICATIONS TRANSMITTAL

The attached Mitsubishi MU-2B series Service Publication has been issued by Mitsubishi Heavy Industries, Ltd. in Japan, who is the type certificate holder of the MU-2 aircraft. It is the owner and/or operator's responsibility to adhere to or comply with new information contained in the attached publication.

SL 107

SL 080/27-001

FAA SAIB CE-19-13 – Flight Control Cables and Terminals

NOTE

THIS PUBLICATION IS PRINTED AND/OR DISTRIBUTED BY MITSUBISHI HEAVY INDUSTRIES AMERICA, INC., UNDER LICENSE FROM MITSUBISHI HEAVY INDUSTRIES LTD. FOR COMMENTS OR INQUIRIES REGARDING DISTRIBUTION OF THIS PUBLICATION OR RECEIPT OF ANY OF THE PUBLICATIONS LISTED HEREIN, PLEASE CONTACT:

Mitsubishi Heavy Industries America, Inc.
Aircraft Product Support Division
4951 Airport Parkway Suite 530
Addison, TX 75001
USA

Phone: (972) 934-5480

Fax: (972) 934-5488

**MU-2**

SERVICE LETTER

MITSUBISHI HEAVY INDUSTRIES, LTD.
NAGOYA AEROSPACE SYSTEMS WORKS
10 OYE-CHO, MINATO-KU, NAGOYA, JAPAN

JCAB T.C.: No. 107

DATE: September 30, 2019

FAA T.C.: No. 080/27-001

SUBJECT: FAA SAIB CE-19-13 – Flight Control Cables and Terminals

MODELS AFFECTED: All MU-2B Airplanes

Federal Aviation Administration (FAA) recently released Special Airworthiness Information Bulletin (SAIB) CE-19-13, dated July 2, 2019, addressing concerns on cracking and fracturing of flight control cable terminal attachment fittings connected to turnbuckle barrels on all 14 CFR Part 23 and CAR Part 3 airplanes with mechanical flight control cables.

For the airplanes with a history of significant exposure to warm, humid, and salt air environments, this SAIB recommends replacement of all primary flight control cables if those cables were in service for more than 15 years. For any cables that have turnbuckle fittings located in an area of the airplane subject to elevated temperatures, the prevalence of condensation, or in close proximity to the airplane battery, this SAIB also recommends replacement of cables and associated components.

This Service Letter is issued to ensure that all MU-2 owners and operators are aware of the release of the attached FAA SAIB CE-19-13. Recommendations from the SAIB include detailed visual inspections of flight control cables, cable terminal fittings and turnbuckles for corrosion or cracking during annual or other general inspections. Although specifically aimed at flight control cables, these concerns apply equally to all cable controls. MHI recommends a thorough review of this FAA SAIB and possible inclusion in your periodic maintenance. For any questions regarding maintenance requirements for Mitsubishi MU-2, please use the following contact information:

Mitsubishi Heavy Industries America, Inc.

Aircraft Product Support Division

4951 Airport Parkway, Suite 530, Addison, TX 75001

Phone: 972-934-5480 / Fax: 972-934-5488

Email: mu-2support@mhia.com / Website: www.mu-2aircraft.com



FAA
Aviation Safety

SPECIAL AIRWORTHINESS INFORMATION BULLETIN

SUBJ: Flight Controls; Cable Terminals Used on 14 CFR Part 23 and CAR
Part 3 Airplanes with Mechanical Flight Control Cables

SAIB: CE-19-13
Date: July 2, 2019

This is information only. Recommendations aren't mandatory.

Introduction

This Special Airworthiness Information Bulletin alerts owners, operators, maintenance technicians, and inspectors of an airworthiness concern, specifically cracking and fracturing of flight control cable terminal attachment fittings connected to turnbuckle barrels on **all 14 CFR part 23 and CAR part 3 airplanes with mechanical flight control cables**.

With the exception of AD 2013-02-13, which addresses specific turnbuckle connections in the stabilator control system on certain Piper Aircraft Inc. airplane models, at this time, the airworthiness concern is not an unsafe condition that would warrant airworthiness directive (AD) action under Title 14 of the Code of Federal Regulations (14 CFR) part 39. However, the FAA continues to monitor this concern, and may take additional action based on data received from operators and/or further examination.

Background

Turnbuckle connections are widely used in flight control systems on a multitude of airplane models that utilize mechanical flight control cables. The FAA has, over the years, received numerous reports of failures of the cable/turnbuckle attachment fittings, which have caused or have the potential to cause loss of flight control in one axis. In many cases, the failures have been discovered during inspection or ground operations. For those that occurred in flight, the pilot was often able to land the airplane without damage, although this can be very challenging. Accidents with substantial damage have occurred in some cases.

The specific focus of this SAIB is on the connecting fittings that are attached (swaged) to the flight control cables and threaded onto the turnbuckles. These fittings are typically manufactured from a type of stainless steel that is susceptible to stress corrosion cracking under certain conditions over time. Based on multiple part examinations, the stress corrosion cracking originates at general corrosion pits on the surface of the parts. Because the cracks are primarily below the surface, they can be extremely difficult to detect. Because stress corrosion cracking is usually preceded by or accompanied with visible corrosion, any presence of even light or moderate corrosion on these fittings is cause for concern.

Factors that contribute to stress corrosion cracking for stainless steel fittings of this type are exposure to contamination (chlorides) along with being under sustained tensile stress. Heat is also a contributing factor. It is therefore likely to occur more quickly in a warm, humid, salt air environment, and progresses based on calendar time rather than flight time. A number of failures have occurred in areas of the airplane adjacent to heating and ventilating ducts, thus raising the possibility that elevated temperatures and/or condensation associated with the ducting was an aggravating factor. Owners and operators of certain Beechcraft Bonanza and Debonair airplane models should be aware that multiple failures of an aileron cable terminal have occurred in a location just forward of the rear spar and underneath a ventilation/heating duct. This applies to most airplane Models 33, 35, and 36 manufactured between approximately 1964 and 1977, after which the aileron

turnbuckles were moved to a location in the wheel well (although there may be exceptions falling outside those years). Being located in close proximity to the airplane battery can also be an aggravating factor. Based on reports received to date, the FAA would not expect failures to occur on parts with less than 15 years time in service.


A picture from a recent incident involving failure of such a fitting is shown in the photographs below. Note the small amount of corrosion adjacent to the fracture location.



Depending on whether safety wire or a safety clip is used to secure the turnbuckle, any corrosion such as this may be hidden from view by the safety wire, which needs to be removed in order to perform an adequate inspection. The following photograph shows a typical safety wire configuration.



The following photograph shows a failure that occurred on a cable fitting located under a ventilation/heating duct on a Beechcraft Bonanza airplane.

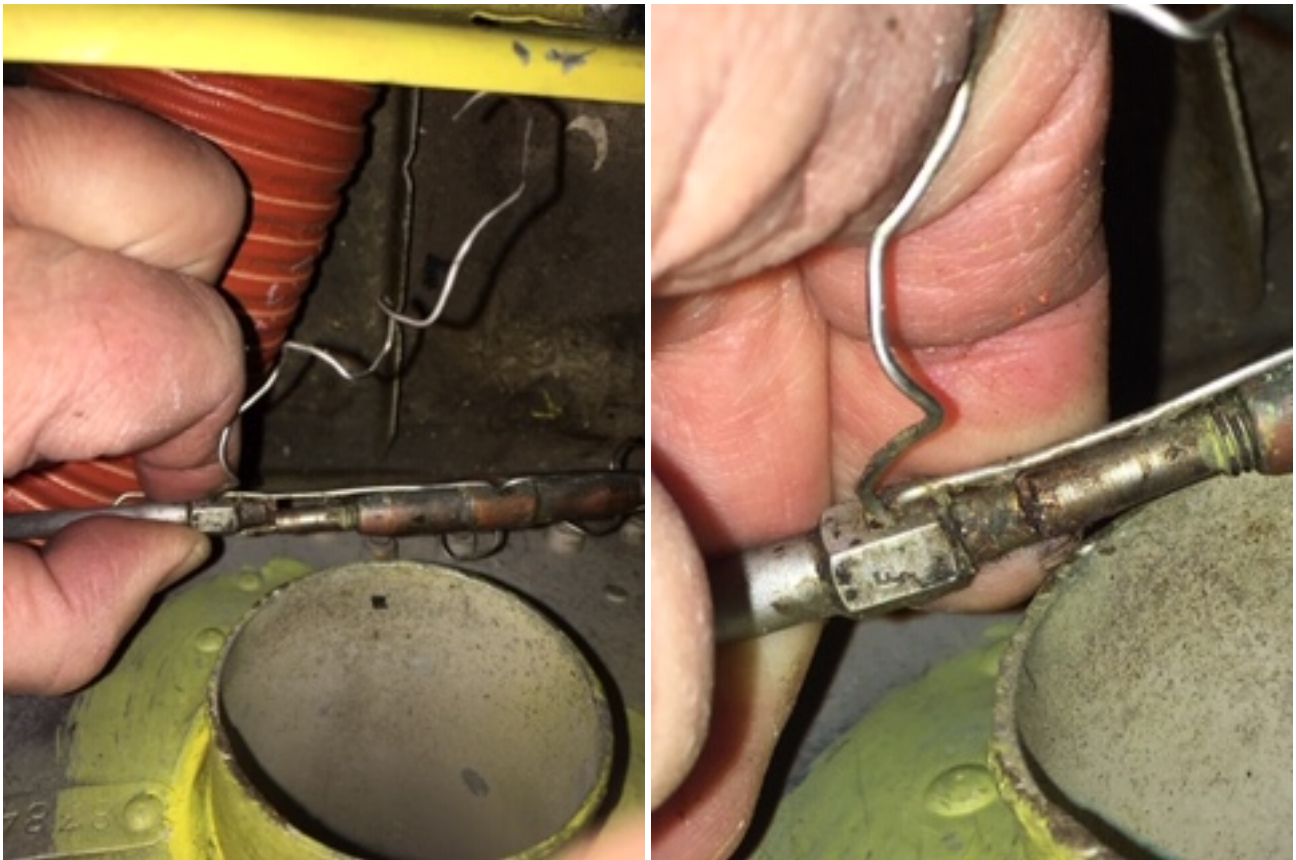

Another aggravating factor is the presence of sleeving or tape that is sometimes installed on the fitting shank for identification as an aid during initial airplane assembly. Corrosion can form more quickly underneath this material and be hidden from view during an inspection as shown in the following photograph. This material has no functional purpose on an assembled airplane.



Again, because stress corrosion cracking is usually preceded by or accompanied with visible corrosion on the fitting, any corrosion visible in the area of the fitting is cause for concern.

Recommendations

For all airplanes certificated under 14 CFR part 23 and CAR part 3 that utilize mechanical flight control cable systems, the FAA recommends that owners and operators perform the following:

1. Upon any annual or other general inspection of the flight control cables, carefully examine all cable terminal fittings that attach to all turnbuckles for corrosion and/or cracking (in addition to inspecting the turnbuckles and the entire length of the cables as you normally would).
 - a. If safety wire is installed such as to prevent examination of the fitting surface, the safety wire must be removed.
Caution: Care should be taken to avoid any adjustment of the turnbuckle relative to the fittings. Otherwise, re-rigging of the affected flight control cables per the manufacturer's instructions should be done before further flight.
 - b. Examine underneath any sleeving or tape that is installed on the fitting shank.
 - i. Remove and discard any such tape or sleeve material while exercising care not to gouge or scratch the fitting surface. Removal of this material is considered a minor alteration to the airplane and should be documented by an appropriate logbook entry.
 - ii. Replacement of any identification marking can be accomplished using normal airplane metal marking techniques such as paint stencil or low chloride permanent marker. Avoid using generic permanent markers, as they may contain chlorides. Low chloride markers are commercially available.
 - c. Use of a 10X magnifier is recommended.
2. If no corrosion or cracking is present:
 - a. Apply a corrosion preventative to the swaged fittings if recommended by the manufacturer.
 - b. Replace any removed safety wire with new safety wire in accordance with normal procedures.
3. If any sign of corrosion, pitting or cracking is present on any fitting, replacement of the associated fitting and/or cable assembly is recommended.
4. For those airplanes with a history of significant exposure to warm, humid, salt air environments, replacement of all primary flight control cables that have been in service for 15 years or longer is recommended. Additionally, replacement of any cable that has a turnbuckle fitting located in an area of the airplane subject to elevated temperatures, the prevalence of condensation, or in close proximity to the airplane battery, and has been in service for 15 years or longer is recommended.

Reference Information:

NTSB Safety Recommendations A-01-6

<https://www.nts.gov/ layouts/ntsb.recsearch/Recommendation.aspx?Rec=A-01-006>

Australian Airworthiness Bulletin 27-001 Issue 7

https://www.casa.gov.au/file/78591/download?token=T_K3aWp9

For Further Information Contact

David Hirt, Aerospace Engineer, 901 Locust, Kansas City, MO 64106; phone: (816) 329-4050; fax: (816) 329-4090; e-mail: david.hirt@faa.gov.

